



# Stepping System Power Supplies


## SureStep® Power Supplies

SureStep Series Specifications – Stepping System Power Supplies				
Power Supply	STP-PWR-3204	STP-PWR-4805	STP-PWR-4810	STP-PWR-7005
Drawing	<a href="#">PDF</a>	<a href="#">PDF</a>	<a href="#">PDF</a>	<a href="#">PDF</a>
Price	\$150.00	\$183.00	\$237.00	\$233.00
Input Power (fuse protected *)	1-phase, 120/240 VAC, 50/60 Hz, 150 VA Fuse*: 3A	1-phase, 120/240 VAC, 50/60 Hz, 350 VA Fuse*: 5A	1-phase, 120/240 VAC, 50/60 Hz, 650 VA Fuse*: 8A	1-phase, 120/240 VAC, 50/60 Hz, 500 VA Fuse*: 7A
Input Voltage Range (switch selectable)	120/240 VAC ±10% (Voltage range switch is set to 240 VAC from factory)			
Inrush Current	120 VAC < 12 A / 240 VAC < 14 A	120 VAC < 20A / 240 VAC < 24A	120 VAC < 40A / 240 VAC < 50A	
Motor Supply Output (linear unregulated, fuse protected *, and power on LED indicator)	32 VDC @ 4A (fully loaded) 35 VDC @ 1A load 41 VDC @ no load Fuse*: 6A (Electrically isolated from Logic Supply Output)	46.5 VDC @ 5A (fully loaded) 52 VDC @ 1A load 57.5 VDC @ no load Fuse*: 8A	46.5 VDC @ 10A (fully loaded) 50 VDC @ 1A load 57.5 VDC @ no load Fuse*: 15A	70 VDC @ 5A (fully loaded) 79 VDC @ 1A load 86.5 VDC @ no load Fuse*: 8A
Logic Supply Output (regulated and power on LED indicator)	5 VDC ±5% @ 500 mA (Electronically Overload Protected) (Electrically isolated from Motor Supply Output)			
Watt Loss	13W	25W	51W	42W
Storage Temperature Range	-55 to 85 °C [-67 to 185 °F]			
Operating Temperature Range	0 to 50 °C [32 to 122 °F] full rated; derate current 1.1% per degree above 50°C; 70 °C [158 °F] maximum			
Humidity	95% (non-condensing) relative humidity maximum			
Cooling Method	Natural convection (mount power supply to metal surface if possible)			
Mounting	Mount on either wide or narrow side with machine screws per dimension diagrams			
Weight (lb [kg])	6.5 [2.9]	11 [4.9]	18 [8.3]	16 [7.2]
Connections	Screw Terminals			
Agency Approvals	UL (file # E181899), CSA, CE			

\* Fuses to be replaced by qualified service personnel only. Use (1-1/4 x 1/4 in) ceramic fast-acting fuses (Edison type ABC from AutomationDirect, or equivalent).

### Power Supply Dimensions

### STP-PWR-3204 Power Supply

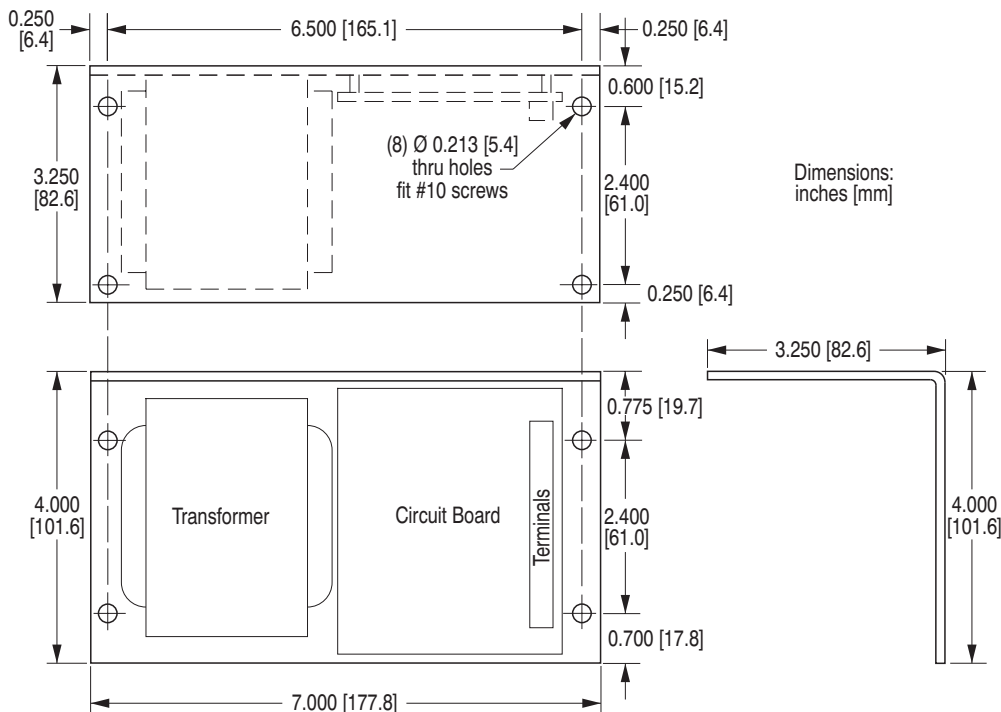




# Stepping System Power Supplies

## SureStep® Power Supply Dimensions (continued)

### STP-PWR-4805, -4810, -7005 Power Supplies

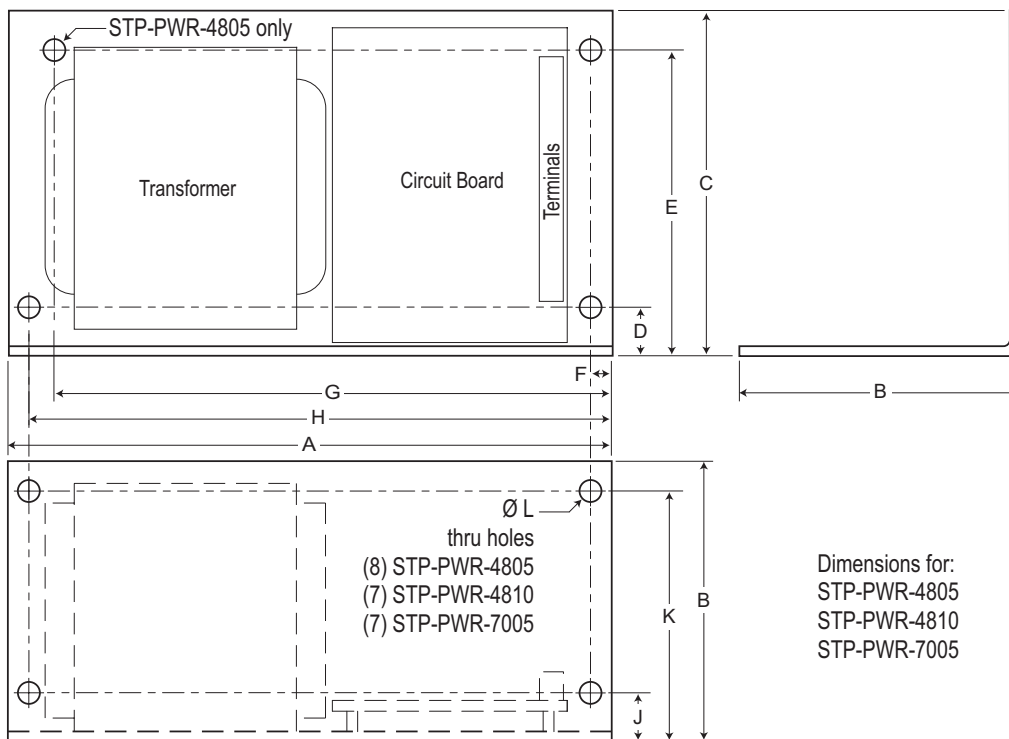

SureStep Series Dimensions – 48V & 70V Power Supplies												
Power Supply Part Number	Dimensions* (in [mm]*)											Mtg Screw
	A	B	C	D	E	F	G	H	J	K	L	
<b>STP-PWR-4805</b>	8.10 [205.7]	3.88 [98.6]	5.00 [127.0]	0.87 [22.1]	4.67 [118.6]	0.25 [6.4]	7.15 [181.6]	7.75 [196.9]	0.50 [12.7]	3.53 [89.7]	0.200 [5.1]	#10
<b>STP-PWR-4810</b>	9.00 [228.6]	4.62 [117.3]	5.62 [142.7]	1.56 [39.6]	4.06 [103.1]	0.35 [8.9]	n/a	8.59 [218.2]	0.50 [12.7]	4.27 [108.5]	9/32 [7.1]	1/4
<b>STP-PWR-7005</b>												

\* mm dimensions are for reference purposes only.