

# Trumeter ADM Series CT Meters



## For AC current measurement when using current transformers


**NEW** digital output delays

**NEW** 10 alarm set points

**NEW** 20-point non-linearization scaling

The CT Meter is designed specifically for use with current transformers. When used with an external current transformer, it can accurately measure current up to 10,000 amps. The CT Meter also provides a range of features including alarm set-points and three-color dynamic backlighting.

The customizable four-character message display and scalability enable users to tailor the meter to display critical parameters to any desired specifications. The set-points, coupled with the backlighting, allow operators to be visually alerted when a parameter is out of range. The two outputs can be used to connect the ADM to other systems in the process.

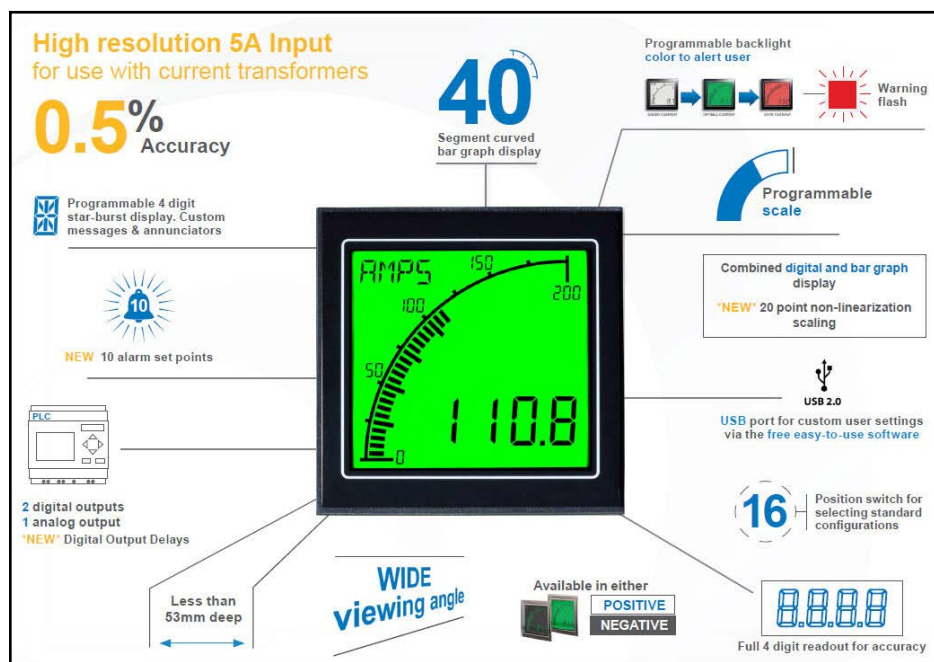

## Key features

- 40-segment bar graph display
- Large 4-digit display
- Separate starburst display area for annunciators, custom messages and alarm information
- Dynamic backlight color
- User-adjustable backlight brightness and color (red, green, white)
- Wide viewing angle (horizontal and vertical)
- Custom annunciators
- Three-year warranty

### ADM100C-LN

#### Negative LCD

Bright digits on black background



### ADM100C-LP

#### Positive LCD

Black digits on bright background



## Overview

### Measurement

- Current range (via external CT): 0-9,999 A
- Accuracy: 0.5 %

### Outputs

- Max voltage: 34V
- Max current: 500mA
- Analog: 4-20 mA

### Power Supply

- 12-24 VAC/VDC, 1.6 W

### Free Configuration Utility Download

- PC utility via USB
- Basic configuration without PC (default setting is amps)

### Display Options

- Positive LCD (bright environments)
- Negative LCD (dark environments)

### Programmable

- Display range (Min and Max values)
- Custom annunciators
- User-selectable backlight color and intensity
- Two independent alarm set-points
- Two independent outputs
- 4-20 mA analog monitor output

# Trumeter ADM Series CT Meters



## Trumeter ADM Series CT Meters Selection Guide

Part Number	Price	Description	Drawing
<a href="#"><b>ADM100C-LN</b></a>	\$91.00	CT meter, programmable, with outputs, negative LCD display	<a href="#">PDF</a>
<a href="#"><b>ADM100C-LP</b></a>	\$91.00	CT meter, programmable, with outputs, positive LCD display	<a href="#">PDF</a>

## Trumeter ADM Series CT Meters Specifications

Part Number	<a href="#"><b>ADM100C-LN</b></a>	<a href="#"><b>ADM100C-LP</b></a>
	<b>Power Supply</b>	
<b>Input</b>	12 - 24 VAC or VDC	
<b>Power Consumption</b>	1.6 W	
<b>Supply Frequency</b>	50-400 Hz	
	<b>Current Input</b>	
<b>Range (CT Output Current)<sup>1</sup></b>	0-5 A	
<b>Range (via external CT)</b>	0-9,999 A	
<b>Accuracy</b>	0.5 %	
	<b>Display</b>	
<b>User Configurable Backlight Colors</b>	Red, Green, White	
<b>Positive/Negative LCD</b>	Negative	Positive
<b>Readout Text Character Size</b>	Four-digit display, 0.47 in [12mm]	
<b>Message Text Character Size</b>	Four-digit display, 0.24 in [6mm]	
<b>Bar Graph Character Size</b>	40 segments, 0.24 in [6mm]	
	<b>Environmental</b>	
<b>Operating Temperature</b>	14 to 140°F [-10 to 60°C]	
<b>Storage Temperature</b>	-40 to 158°F [-40 to 70°C]	
<b>IP Rating (from the front)</b>	IP65, NEMA type 4 and NEMA type 12	
	<b>Analog Outputs (2)</b>	
<b>Analog Output</b>	4-20 mA	
<b>Accuracy</b>	0.50% (full-scale deflection or FSD)	
<b>Resolution</b>	0.02 mA	
	<b>Open Collector Outputs (2)</b>	
<b>Max Voltage</b>	34VDC	
<b>Max Current</b>	500mA	
	<b>Programming</b>	
<b>Programming Port</b>	USB 2.0 (requires USB Type A to Type B cable, sold separately – USB-CBL-AB3, AB6, AB10 or AB15)	
	<b>Agency Approvals</b>	
<b>Certification</b>	UL File # E469787, CE	
	<b>Mechanical</b>	
<b>Wire Connection Type</b>	Screw Terminals	
<b>Wire Gauge (Solid or Stranded)</b>	18AWG to 12AWG (0.8 mm <sup>2</sup> - 3.3 mm <sup>2</sup> ). Torque 0.5-0.6 Nm [4.43-5.31 lb-in]	
<b>Weight</b>	6.35 oz (180g)	
<b>Mounting Clips Screw Torque</b>	<0.4 N•m [3.54 lb•in]	

**Note 1 - Caution: The ADM CT meter has been designed to be used with an external current transformer. Never connect the meter directly to a live circuit.**


# Trumeter ADM Series CT Meters



## Wiring Diagram


CT METER  
Using Current Transformer

All fuses must be 0.5A / 250V Type F (fast acting fuse) with a breaking capacity of 35A or greater.

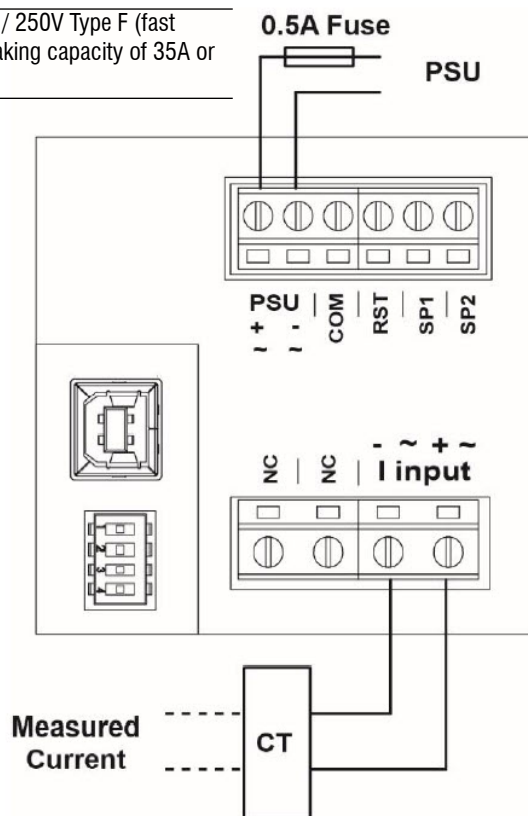

## Easy-To-Use Configuration Tool

*Just plug into any USB port on your PC, run the free ADM Configuration application, and you're off.*

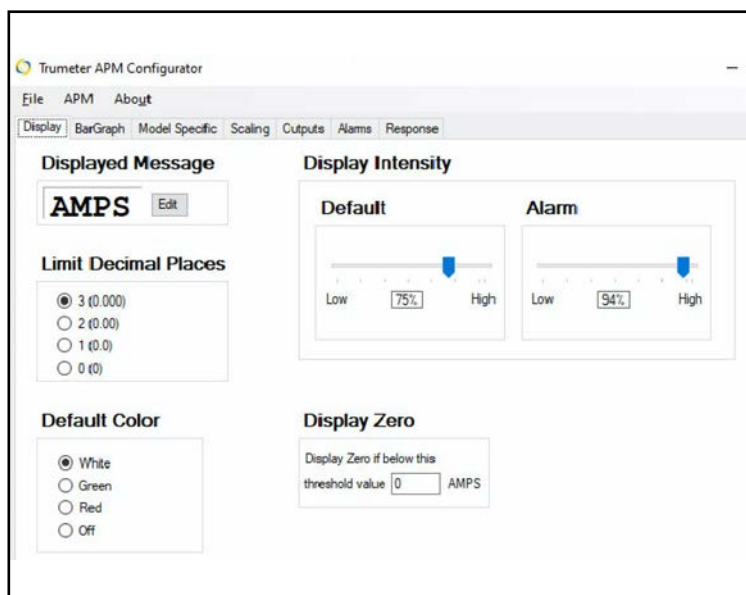

# Trumeter ADM Series Process Meters

## For industrial process monitoring applications

**NEW digital output delays**

**NEW 10 alarm set points**


**NEW 20-point non-linearization scaling**

Trumeter ADM Series Process Meters feature an acclaimed easy-to-read display and a versatile set of inputs, making them ideal for a wide range of industrial applications.

The programmable scale and custom annunciators allow users to tailor the meter to display critical parameters exactly as desired. In addition, dynamic backlighting, in conjunction with setpoints, alerts operators visually when a parameter is out of range. These meters also feature two outputs which can be used to control other systems in the process. The ADM Process Meter is much more than just a display.

Trumeter's innovative technology brings a greater level of accuracy to the ADM range through input signal optimization. By using this technology, accuracy of 0.1% or better is now achieved, allowing for more precise measurement, display and control.

Non-linear sensors such as thermocouples and pressure transducers can also be used, thanks to the new ADM Configurator application which allows the user to configure up to 20 points in a non-linear conversion table.

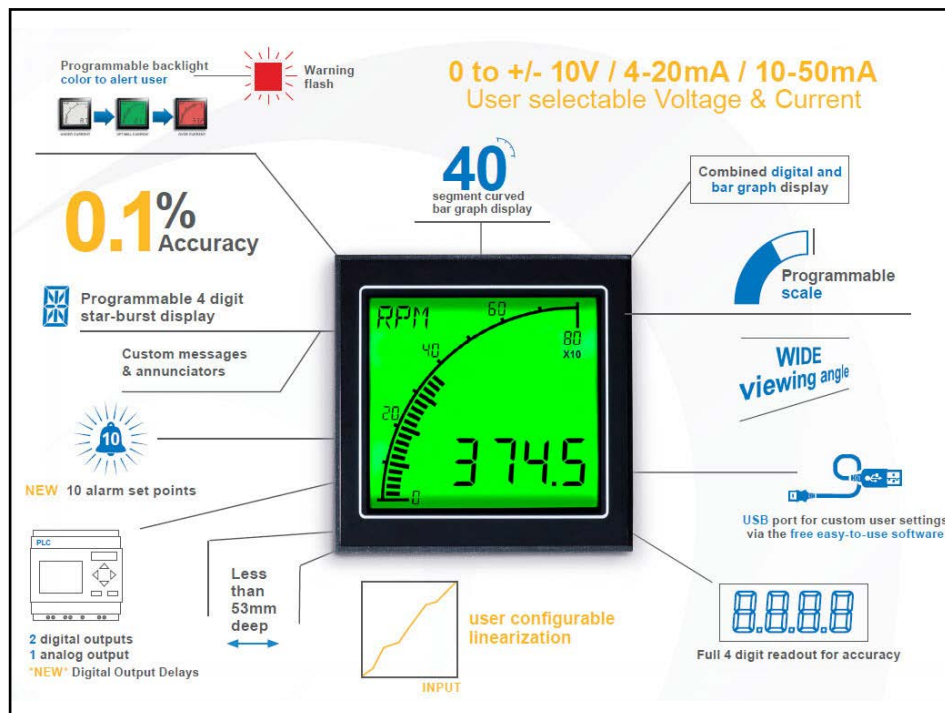

## Key features

- 40-segment bar graph display
- Large 4-digit display
- Separate starburst display area for annunciators, custom messages and alarm information
- Dynamic backlight color
- User-adjustable backlight brightness and color (red, green, white)
- Wide viewing angle (horizontal and vertical)
- Custom annunciators
- Three-year warranty



### ADM100P-LN

#### Negative LCD

Bright digits on black background



### ADM100P-LP

#### Positive LCD

Black digits on bright background



## Overview

### Voltage Input

- 0 to +/- 10VDC, impedance 100KΩ
- Accuracy: 0.1 % of input or 5mV, whichever is greater

### Current Input

- 0-50 mA, impedance 15Ω
- Accuracy: 0.01 % of input or 5μA, whichever is greater

### Outputs

- Max voltage: 34V
- Max current: 500mA
- Analog: 4-20 mA

### Power Supply

- Nominal input: 12-24 VAC/VDC. 1.6 W

### Free Configuration Utility Download

- PC utility via USB
- Basic configuration without PC (default setting is volts)

### Display Options

- Positive LCD (bright environments)
- Negative LCD (dark environments)

### Programmable

- Display range (Min and Max values)
- Custom annunciators
- User-selectable backlight color and intensity
- Two independent alarm set-points
- Two independent outputs
- 4-20 mA analog retransmission output

# Trumeter ADM Series Process Meters



## Trumeter ADM Series Process Meters Selection Guide

Part Number	Price	Description	Drawing
<b>ADM100P-LN</b>	\$100.00	Process meter, programmable, with outputs, negative LCD display	<a href="#">PDF</a>
<b>ADM100P-LP</b>	\$100.00	Process meter, programmable, with outputs, positive LCD display	<a href="#">PDF</a>

## Trumeter ADM Series Process Meters Specifications

Part Number	ADM100P-LN	ADM100P-LP
	Power Supply	
Input	12 - 24 VAC/VDC	
Power Consumption	1.6 W	
Supply Frequency	50-400 Hz	
	Voltage Input	
Range	0 to +/-10VDC	
Impedance	100KΩ	
Accuracy	0.1 % of input or 5mV, whichever is greater	
	Current Input	
Range	0 to 50 mA	
Impedance	15Ω	
Accuracy	0.01 % of input or 5μA, whichever is greater	
	Display	
User Configurable Backlight Colors	Red, Green, White	
Positive/Negative LCD	Negative	Positive
Readout Text Character Size	Four-digit display, 0.47 in [12mm]	
Message Text Character Size	Four-digit display, 0.24 in [6mm]	
Bar Graph Character Size	40 segments, 0.24 in [6mm]	
	Environmental	
Operating Temperature	14 to 140°F [-10 to 60°C]	
Storage Temperature	-40 to 158°F [-40 to 70°C]	
IP Rating (from the front)	IP65, NEMA type 4 and NEMA type 12	
	Analog Outputs (2)	
Analog Output	4-20 mA	
Accuracy	0.50% (full-scale deflection or FSD)	
Resolution	0.02 mA	
	Open Collector Outputs (2)	
Max Voltage	34VDC	
Max Current	500mA	
	Programming	
Programming Port	USB 2.0 (requires USB Type A to Type B cable, sold separately – USB-CBL-AB3, AB6, AB10 or AB15)	
	Agency Approvals	
Certification	UL file # E469787, CE	
	Mechanical	
Wire Connection Type	Screw terminals	
Wire Gauge (Solid or Stranded)	18AWG to 12AWG (0.8 mm <sup>2</sup> - 3.3 mm <sup>2</sup> ). Torque 0.5-0.6 N•m [4.43-5.31 lb•in]	
Weight	6.35 oz (180g)	
Mounting Clips Screw Torque	< 0.4 N•m [3.54 lb•in]	






# Trumeter ADM Series Process Meters




## Wiring Diagrams

All fuses must be 0.5A / 250V Type F (fast acting fuse) with a breaking capacity of 35A or greater.

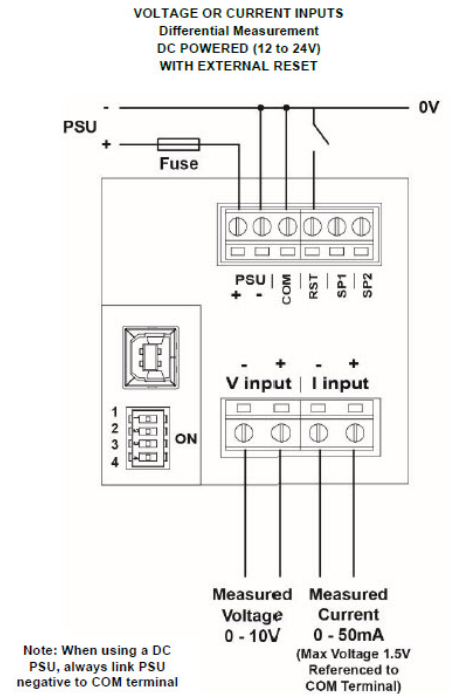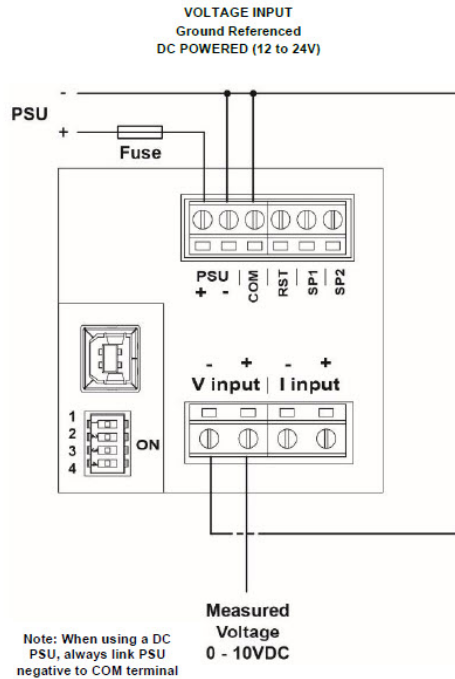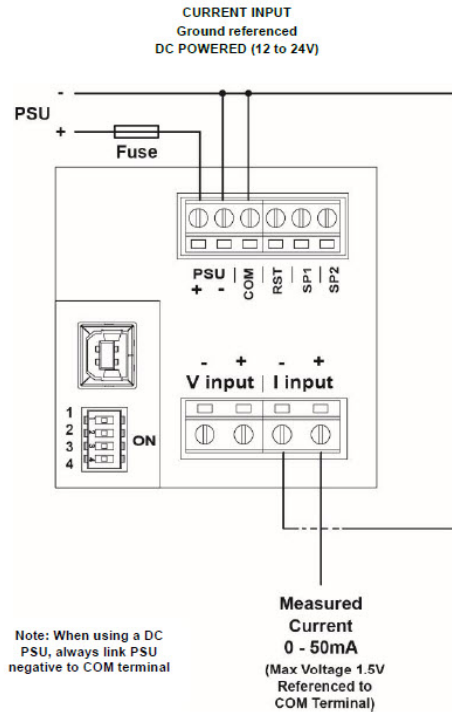

## Easy-To-Use Configuration Tool

Just plug into any USB port on your PC, run the free ADM Configuration application, and you're off.

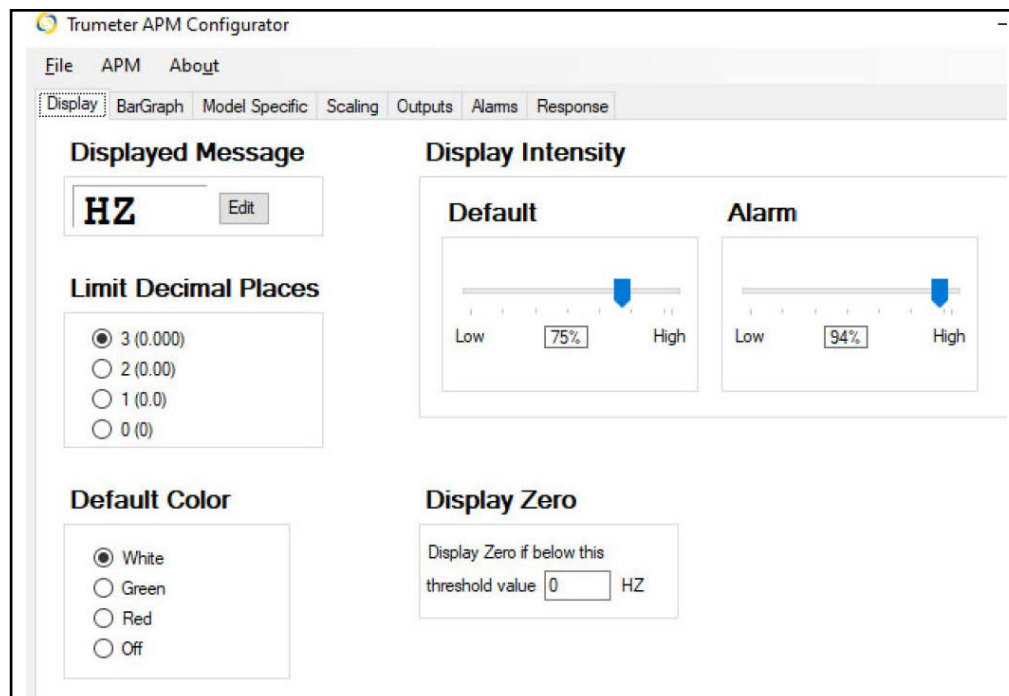


# Trumeter ADM Series Process Meters



## Application Example: Fluid Level

The ADM Process Meter is used to display the volume of fluid in the tank. The 4-20 mA analog output from the fluid level sensor is scaled to gallons and the custom annunciator is set to "Gal," all via the easy-to-use software application.

High and low setpoints are configured so that the normal green display will flash red when the tank is too full or empty, thereby alerting the operator. Additionally, the ADM's digital outputs are integrated into the tank pumping system, and the tank is automatically drained or filled if the setpoints are exceeded.

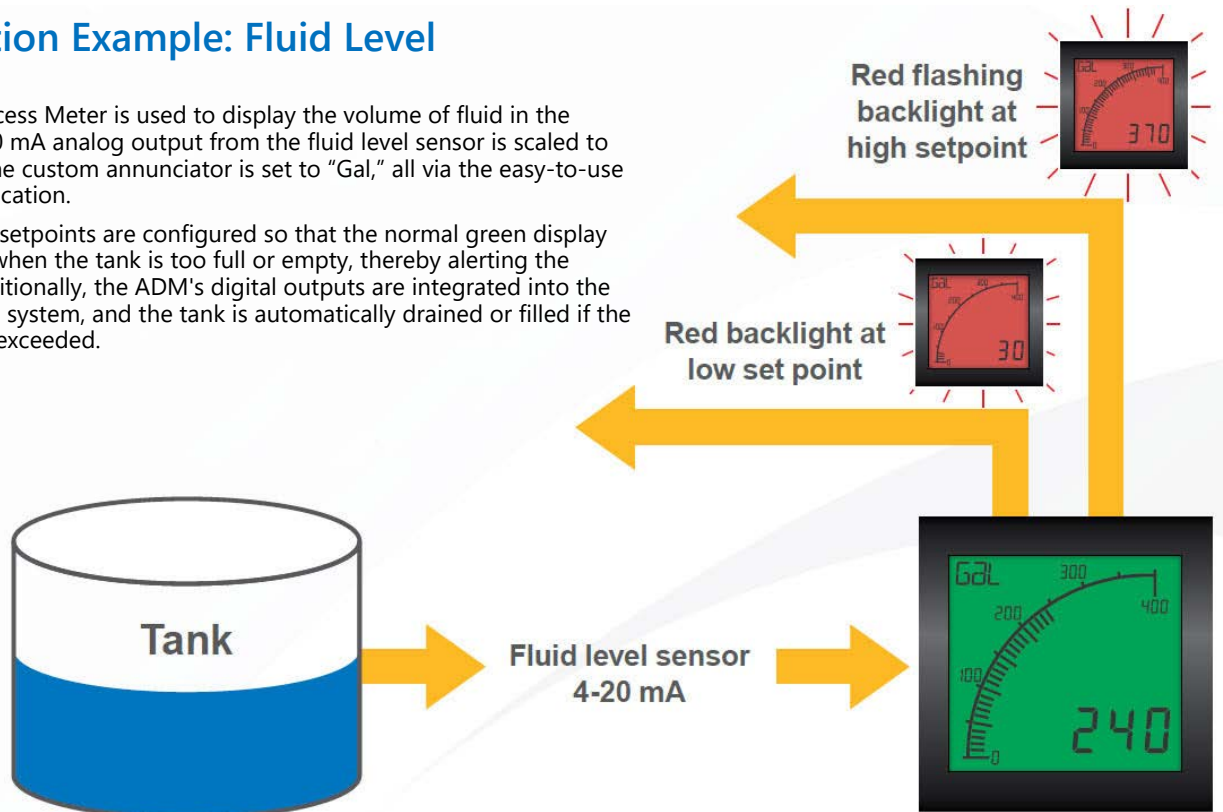


## Application Example: Silo Volume

The ADM Process Meter is used to display the volume of material in the silo, using the analog output from a level sensor.

The signal from the sensor is scaled to measure cubic meters, and the annunciator is customized to  $m^3$ , all via the easy-to-use software. Due to the irregular shape of the silo, the 20-point linearization table is used to correct the non-linear signal from the sensor.

The displayed value accurately shows the volume in the silo. High or low setpoints can be set, and the ADM Process Meter can be integrated into other systems for process control.

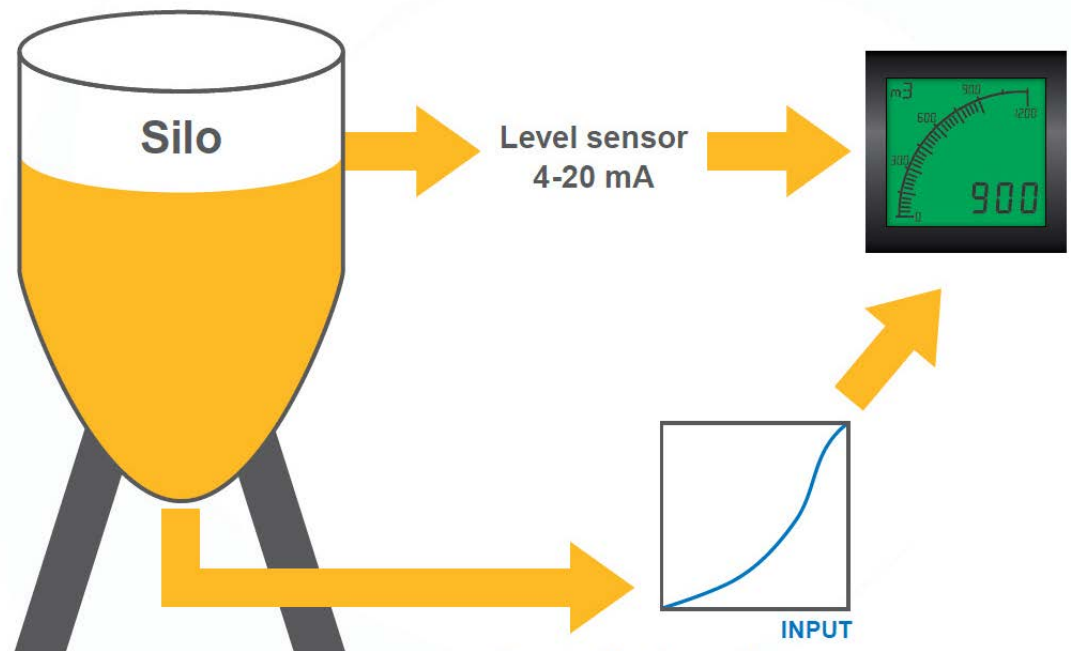

# Trumeter ADM Series Rate Meters



Ideal for use in flow, production line and motor speed monitoring applications

**NEW digital output delays**


**NEW 10 alarm set points**

**NEW 20-point non-linearization scaling**

The ADM Rate Meter was developed for use in monitoring flow, production lines and motor speed. It combines the instant visual representation of an analog meter with the speed and accuracy of a digital meter.

The unique display is viewable in most environmental conditions. It features a programmable scale and color-changing backlight for instant recognition and precision measurement.

The ADM Rate Meter improves safety and efficiency through user-programmable alarm set-points, dynamic backlighting and starburst messaging that alerts operators of changing conditions instantly. It features digital and analog outputs to communicate with other components in a system, IP65 and NEMA type 4 and 12 ratings and an industry leading three-year warranty.

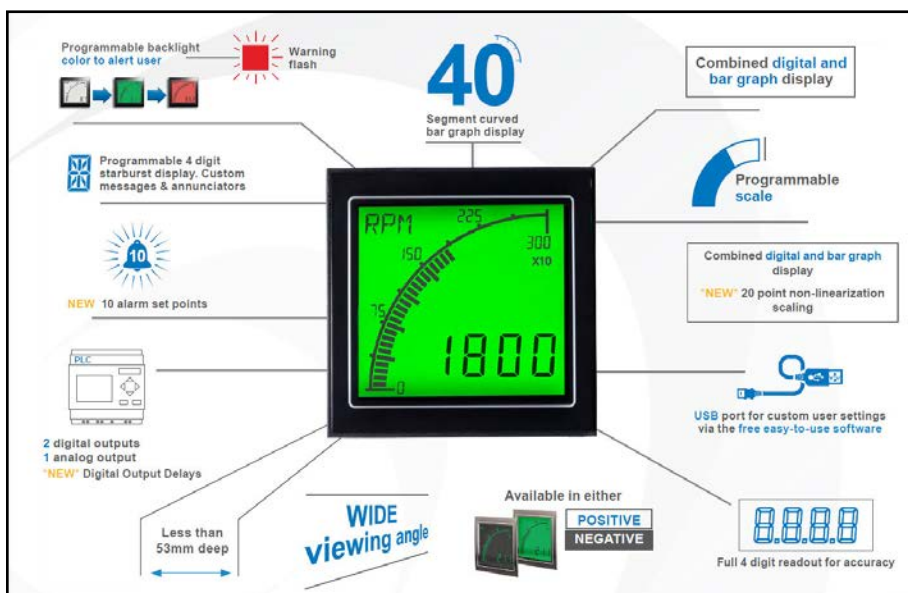

## ADM100R-LN

### Negative LCD

Bright digits on black background



## ADM100R-LP

### Positive LCD

Black digits on bright background



## Overview

### Measurement

- Max frequency: 60kHz
- Min frequency: 0.001 Hz
- Accuracy: 0.01 %

### Max Working Voltage

- Input-COM: 36 VDC

### Outputs

- Max voltage: 34V
- Max current: 500mA
- Analog: 4-20 mA

### Power Supply

- 12-24 VDC, 1.6 W

### Free Configuration Utility Download

- PC utility via USB
- Basic configuration without PC (default setting is Hertz)

### Display Options

- Positive LCD (bright environments)
- Negative LCD (dark environments)

### Programmable

- Scale and Gain
- Custom annunciators
- User selectable backlight color and intensity
- Two independent alarm set-points
- Two independent outputs
- 4-20 mA analog monitor output

## Key features

- 40-segment bar graph display
- Large 4-digit display
- Separate starburst display area for annunciators, custom messages and alarm information
- Dynamic backlight color
- User-adjustable backlight brightness and color (red, green, white)
- Wide viewing angle (horizontal and vertical)
- Custom annunciators
- Three-year warranty



# Trumeter ADM Series Rate Meters



## Trumeter ADM Series Rate Meters Selection Guide

Part Number	Price	Description	Drawing
<b><a href="#">ADM100R-LN</a></b>	\$100.00	Rate meter, programmable, with outputs, negative LCD display	<a href="#">PDF</a>
<b><a href="#">ADM100R-LP</a></b>	\$100.00	Rate meter, programmable, with outputs, positive LCD display	<a href="#">PDF</a>

## Trumeter ADM Series Rate Meters Specifications


Part Number	<b><a href="#">ADM100R-LN</a></b>	<b><a href="#">ADM100R-LP</a></b>
	<b>Measurement</b>	
Max Frequency	60kHz	
Min Frequency	0.001 Hz	
Logic 0	<1.2 V	
Logic 1	> 2.0 V	
Accuracy	±0.01% (full-scale deflection or FSD)	
Max Working Voltage (input - COM)	36VDC	
	<b>Power Supply</b>	
Nominal Input	12-24 VDC	
Power Consumption	1.6 w	
	<b>Display</b>	
Display Update Time	0.1 to 999.9 s	
Scaling Factor	-100 to 1990x10	
User Configurable Backlight Colors	Red, Green, White	
Positive/Negative LCD	Negative	Positive
Readout Text Character Size	Four-digit display, 0.47 in [12mm]	
Message Text Character Size	Four-digit display, 0.24 in [6mm]	
Bar Graph Character Size	40 segments, 0.24 in [6mm]	
	<b>Environmental</b>	
Operating Temperature	14 to 140°F [-10 to 60°C]	
Storage Temperature	-40 to 158°F [-40 to 70°C]	
IP Rating (from the front)	IP65, NEMA type 4 and NEMA type 12	
	<b>Outputs</b>	
Analog Output	4-20 mA	
Max Voltage	34VDC	
Max Current	500mA	
	<b>Programming</b>	
Programming Port	USB 2.0 (requires USB Type A to Type B cable, sold separately – USB-CBL-AB3, AB6, AB10 or AB15)	
	<b>Agency Approvals</b>	
Certification	UL file # E469787, CE	
	<b>Mechanical</b>	
Wire Connection Type	Screw terminals	
Wire Gauge (Solid or Stranded)	18AWG to 12AWG (0.8 mm <sup>2</sup> - 3.3 mm <sup>2</sup> ). Torque 0.5-0.6 N•m [4.43-5.31 lb•in]	
Weight	6.35 oz (180g)	
Mounting Clips Screw Torque	<0.4 N•m [3.54 lb•in]	

# Trumeter ADM Series Rate Meters




## Wiring Diagrams

All fuses must be 0.5A / 250V Type F (fast acting fuse) with a breaking capacity of 35A or greater.

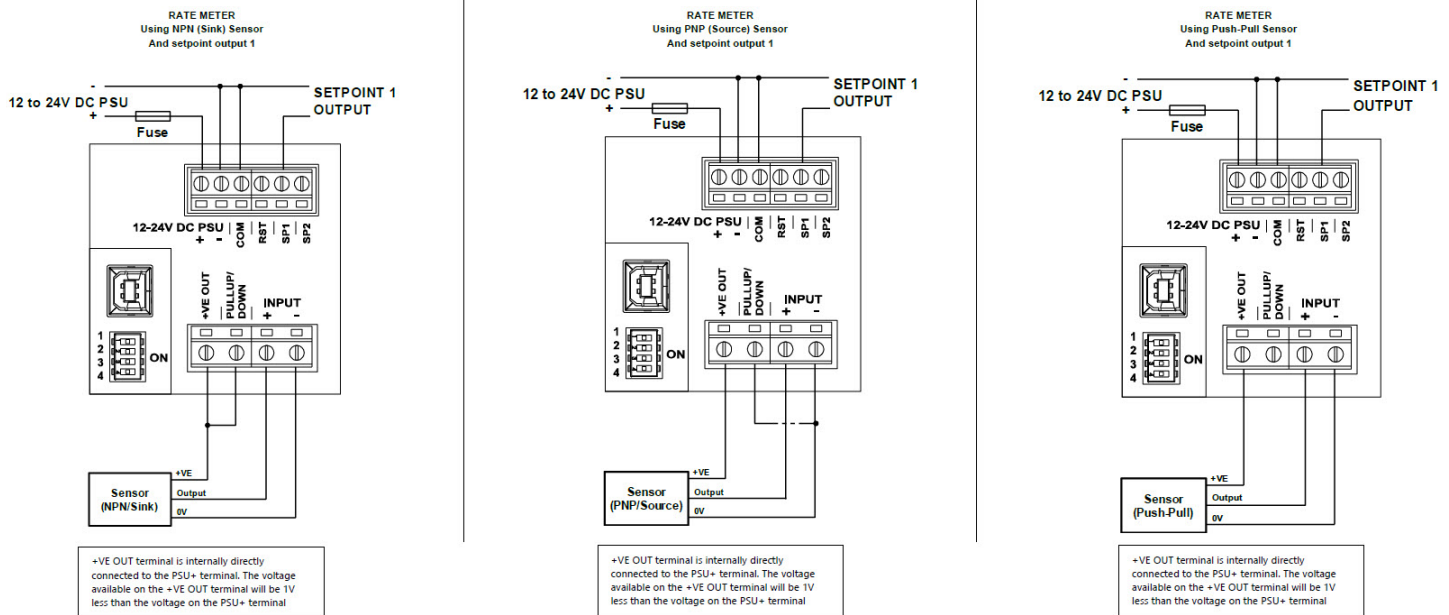

## Easy-To-Use Configuration Tool

Just plug into any USB port on your PC, run the free ADM Configuration application, and you're off.

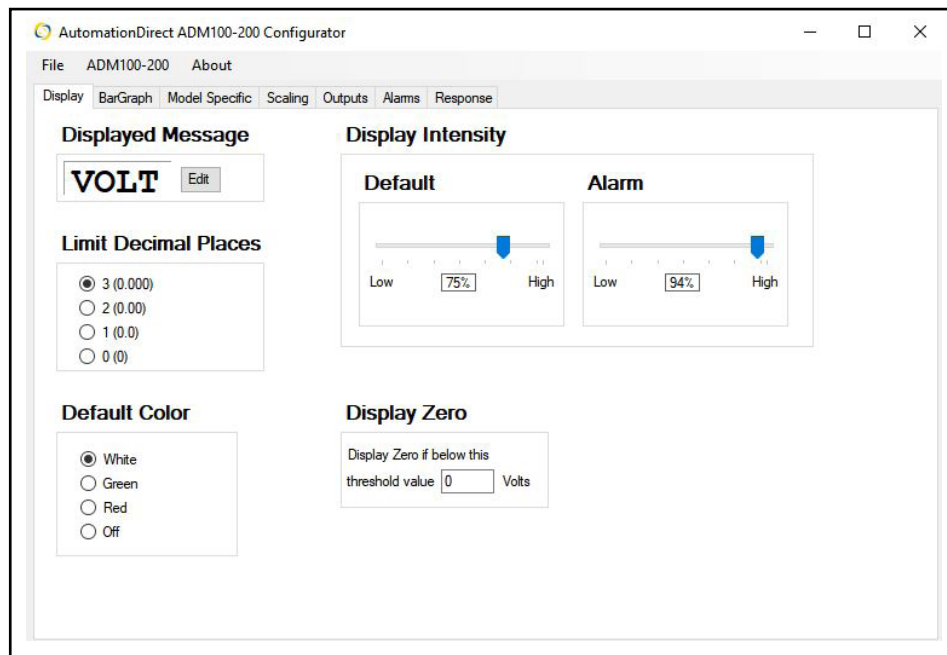

# Trumeter ADM Series Temperature Meters



## For use with thermocouples


Featuring an acclaimed easy-to-read display and a versatile set of inputs, the Trumeter temperature meters take the ADM series into a wide range of new industrial applications.

The programmable scale and custom annunciators allow users to tailor the meter to display critical parameters exactly as desired, while the dynamic backlighting, in conjunction with setpoints, allows operators to be visually alerted when a parameter is out of range.

The two outputs can be used to control other systems in the process, meaning the ADM Temperature Meter is much more than just a display.

Trumeter's innovative input signal optimization achieves accuracy of 0.25% for precise measurement, display and control. Designed for use with thermocouples, the Temperature meter allows the user to configure up to 20 points in a non-linear conversion table via the ADM Configurator application in addition to the built-in thermocouple linearization.

UL file # E469787

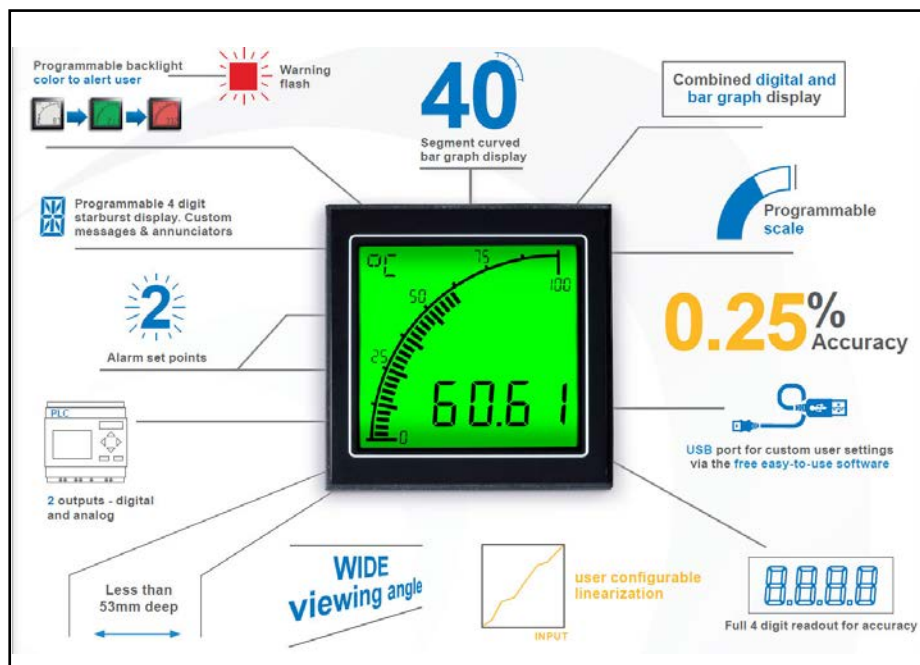

## Key features

- 40-segment bar graph display
- Large 4-digit display
- Separate starburst display area for annunciators, custom messages and alarm information
- Dynamic backlight color
- User-adjustable backlight brightness and color (red, green, white)
- Wide viewing angle (horizontal and vertical)
- Custom annunciators
- Three-year warranty

### ADM100T-LN

#### Negative LCD

Bright digits on black background



### ADM100T-LP

#### Positive LCD

Black digits on bright background



## Overview

### Thermocouple

- Type B, E, J, K, N, R, S and T
- Accuracy 0.25% of full scale

### Outputs

- Max voltage: 34V
- Max current: 500mA
- Analog: 4-20 mA

### Power Supply

- 12-24 VAC/VDC, 1.6 W

### Free Configuration Utility Download

- PC utility via USB
- Basic configuration without PC (default setting is Centigrade [C])

### Display Options

- Positive LCD (bright environments)
- Negative LCD (dark environments)

### Programmable

- Display range (Min & Max values)
- Custom annunciators
- User-selectable backlight color and intensity
- Two independent alarm set-points
- Two independent outputs
- 4-20 mA analog retransmission output

# Trumeter ADM Series Temperature Meters



## Trumeter ADM Series Temperature Meters Selection Guide

Part Number	Price	Description	Drawing
<b>ADM100T-LN</b>	\$115.00	Temperature meter for use with thermocouple, programmable, with outputs, negative LCD display	<a href="#">PDF</a>
<b>ADM100T-LP</b>	\$115.00	Temperature meter for use with thermocouple, programmable, with outputs, positive LCD display	<a href="#">PDF</a>

## Trumeter ADM Series Temperature Meters Specifications


Part Number	ADM100T-LN	ADM100T-LP
	<b>Measurement</b>	
<b>Input</b>	Thermocouple Type B, E, J, K, N, R, S and T	
<b>Accuracy</b>	0.25% of full scale	
	<b>Power Supply</b>	
<b>Nominal Input</b>	12-24 VDC/VAC	
<b>Max Power</b>	1.6 W	
<b>Frequency</b>	DC or 50-400 Hz	
	<b>Display</b>	
<b>User Configurable Backlight Colors</b>	Red, Green, White	
<b>Positive/Negative LCD</b>	Negative	Positive
<b>Readout Text Character Size</b>	Four-digit display, 0.47 in [12mm]	
<b>Message Text Character Size</b>	Four-digit display, 0.24 in [6mm]	
<b>Bar Graph Character Size</b>	40 segments, 0.24 in [6mm]	
	<b>Environmental</b>	
<b>Operating Temperature</b>	14 to 140°F [-10 to 60°C]	
<b>Storage Temperature</b>	-40 to 158°F [-40 to 70°C]	
<b>IP Rating (from the front)</b>	IP65, NEMA type 4 and NEMA type 12	
	<b>Outputs</b>	
<b>Max Voltage</b>	34VDC	
<b>Max Current</b>	500mA	
<b>Analog Output</b>	4-20 mA	
	<b>Programming</b>	
<b>Programming Port</b>	USB 2.0 (requires USB Type A to Type B cable, sold separately – USB-CBL-AB3, AB6, AB10 or AB15)	
	<b>Agency Approvals</b>	
<b>Certification</b>	UL file # E469787, CE	
	<b>Mechanical</b>	
<b>Wire Connection Type</b>	Screw terminals	
<b>Wire Gauge (Solid or Stranded)</b>	18AWG to 12AWG (0.8 mm <sup>2</sup> - 3.3 mm <sup>2</sup> ). Torque 0.5-0.6 N•m [4.43-5.31 lb•in]	
<b>Weight</b>	6.35 oz (180g)	
<b>Mounting Clips Screw Torque</b>	<0.4 N•m [3.54 lb•in]	

# Trumeter ADM Series Temperature Meters



## Wiring Diagrams

Thermocouple Input

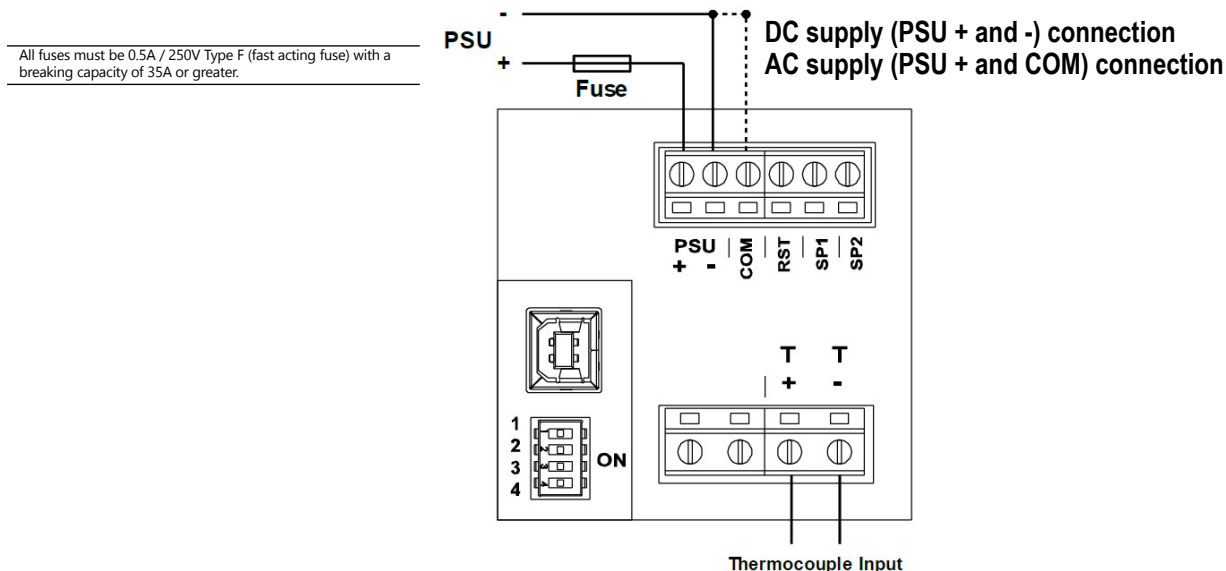

## Easy-To-Use Configuration Tool

*Just plug into any USB port on your PC, run the free ADM Configuration application, and you're off.*

